



McGuire Manufacturing Co., Inc.

60 Grandview Court
 P.O. Box 746 • Cheshire, CT 06410
 203-699-1801 • Fax: 203-699-1813
 www.mcguiremfg.com

PRODUCT SPECIFICATION


Part No.

**8088, 8089, 8089CNC,
 8090, 8090CNC, 1207, 1208**

**Cast P-Trap Ground Joint
 Swivel With Or
 Without Cleanout**

Job Name:

Submittal Number:

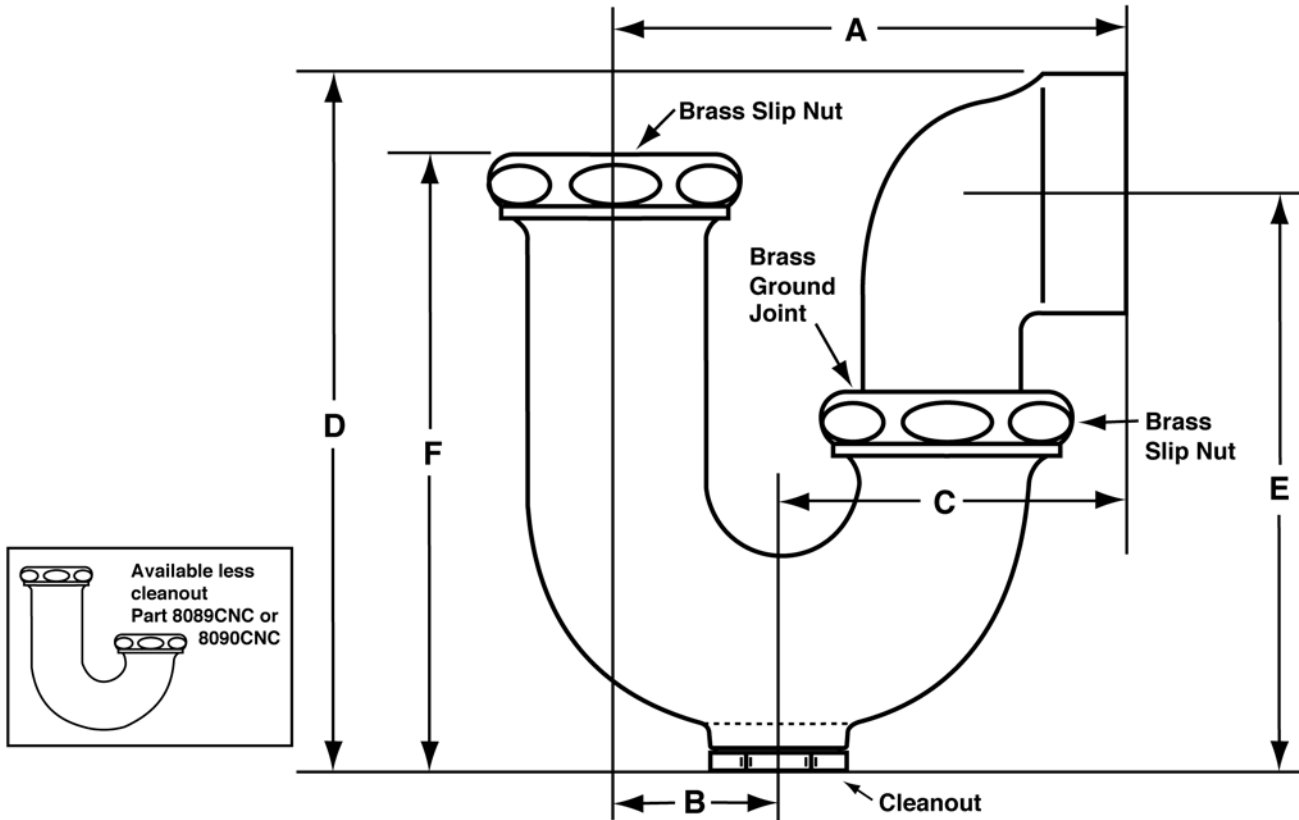

ROUGHING MEASUREMENTS								
NO.	TRAP DIMENSIONS		A	B	C	D	E	F
	INLET	OUTLET						
8088	1-1/4" x 1-1/4"	IPS 1-1/4"	4-3/16"	1-1/4"	2-15/16"	5-1/2"	4-1/2"	5"
8089	1-1/2" x 1-1/2"	IPS 1-1/2"	4-1/4"	1-3/8"	2-7/8"	5-3/4"	4-5/8"	5"
8089CNC	1-1/2" x 1-1/2"	IPS 1-1/2"	4-1/4"	1-3/8"	2-7/8"	5-3/8"	4-1/4"	4-5/8"
8090	1-1/4" x 1-1/2"	IPS 1-1/2"	4-1/4"	1-3/8"	2-7/8"	5-3/4"	4-5/8"	5"
8090CNC	1-1/4" x 1-1/2"	IPS 1-1/2"	4-1/4"	1-3/8"	2-7/8"	5-3/8"	4-1/4"	4-5/8"
1207	1-1/2"	IPS 2"	5-3/8"	1-3/4"	3-5/8"	6-5/8"	5-1/4"	5-1/16"
1208	2"	IPS 2"	5-3/8"	1-3/4"	3-5/8"	6-5/8"	5-1/4"	5-1/16"

**FED SPEC W.W.P. 541
 CAST BRASS P-TRAP
 MINIMUM SEAL 2"**

See options and accessories section for details on product variations.



ASME A112.18.1-2011/CSA B125.2-11

Specifications:

P-Trap shall be chrome plated cast brass body (with, without) cleanout, cast brass ground joint elbow and cast brass slip nut. **No reducing washers.** With (shallow, deep, bell) (steel, brass) or (forged brass with set screw) flange. P-Trap shall be McGuire (8088, 8089, 8090, 1207, 1208). Trap shall be certified by CSA or other recognized testing authority. P-Trap shall bear manufacturer and testing mark.